

## PGM-FI WARNING INDICATOR 23 BLINKS (O<sub>2</sub> SENSOR HEATER: AFTER '99 CALIFORNIA TYPE ONLY)

Turn the ignition switch to "OFF".

Disconnect the O<sub>2</sub> sensor connector.  
Check for loose or poor contact on the O<sub>2</sub> sensor connector.



Connect the O<sub>2</sub> sensor connector.  
Place the motorcycle on its side stand.  
Start the engine and check that the malfunction indicator blinks.

23 blinks


Turn the ignition switch to "OFF".

Disconnect the O<sub>2</sub> sensor 4P connector.  
Measure the resistance at the sensor side connector White terminals.



Connection: White-White  
Standard: 10-40 Ω

Normal

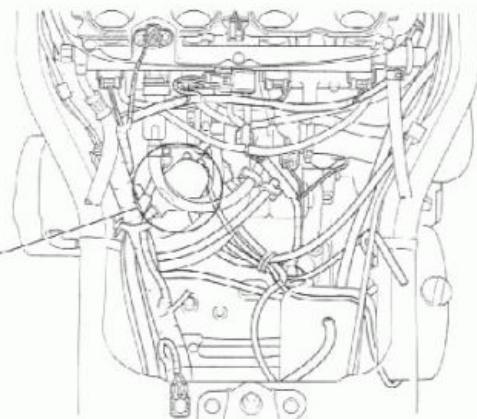

Does not blink → • Loose or poor contacts on the O<sub>2</sub> sensor connector.

Out of range → • Faulty O<sub>2</sub> sensor.