## **Brakes**

2. Remove the inspection hole plug (2).


3. Measure the lining thickness (3) on both front wheels:

Standard: 4.0 mm (0.16 in) Service Limit: 1.0 mm (0.04 in)

If either lining is worn beyond the limit, both brake shoes must be replaced by your Honda dealer.

- 4. If the brake lever freeplay and the brake shoe lining thickness are within the recommended limits, reinstall the inspection hole plugs, seating them into the inspection hole as shown.
- 5. If the brake lever freeplay is excessive but the linings are not worn beyond the service limit, adjust the brake lining clearance.

## **FRONT**

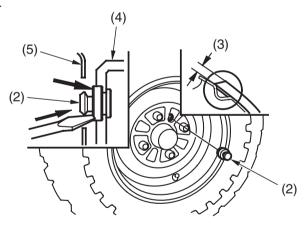

- (2) inspection hole plug
- (3) lining thickness

- (4) front brake drum
- (5) front wheel rim