


5. Injector Signal Line Short Circuit Inspection

Check for continuity between the ECM 32P connector terminal and ground.

Connection: SIGNAL AT ECM – Ground

Is there continuity?

- YES** – • Short circuit in the SIGNAL LINE wire
• Faulty injector
- NO** – Replace the ECM with a known good one, and recheck

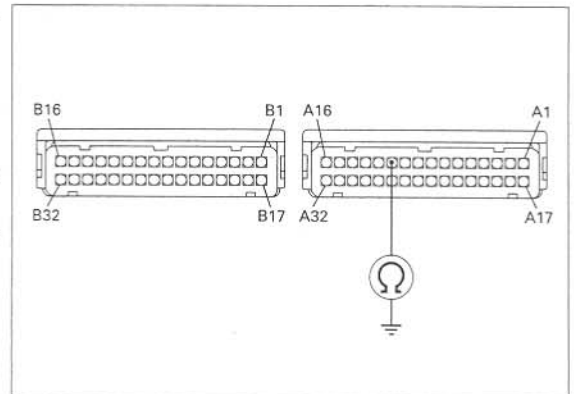

**DTC 13-1
(No.2 PRIMARY INJECTOR)**

(page 6-47)

**DTC 14-1
(No.3 PRIMARY INJECTOR)**

(page 6-47)

**DTC 15-1
(No.4 PRIMARY INJECTOR)**

(page 6-47)

**DTC 16-1
(No.1 SECONDARY INJECTOR)**

(page 6-47)

**DTC 17-1
(No.2 SECONDARY INJECTOR)**

(page 6-47)

**DTC 48-1
(No.3 SECONDARY INJECTOR)**

(page 6-47)

**DTC 49-1
(No.4 SECONDARY INJECTOR)**

(page 6-47)